


BLACKMER PARTS LIST
PUMP MODEL: CRYO-MACH SERIES
2x4x6 C-C

Page 1 of 2		PARTS LIST
		1401-A01-05
Section	Effective	1401
Replaces	Oct 2026	New

CROSS SECTION DRAWING

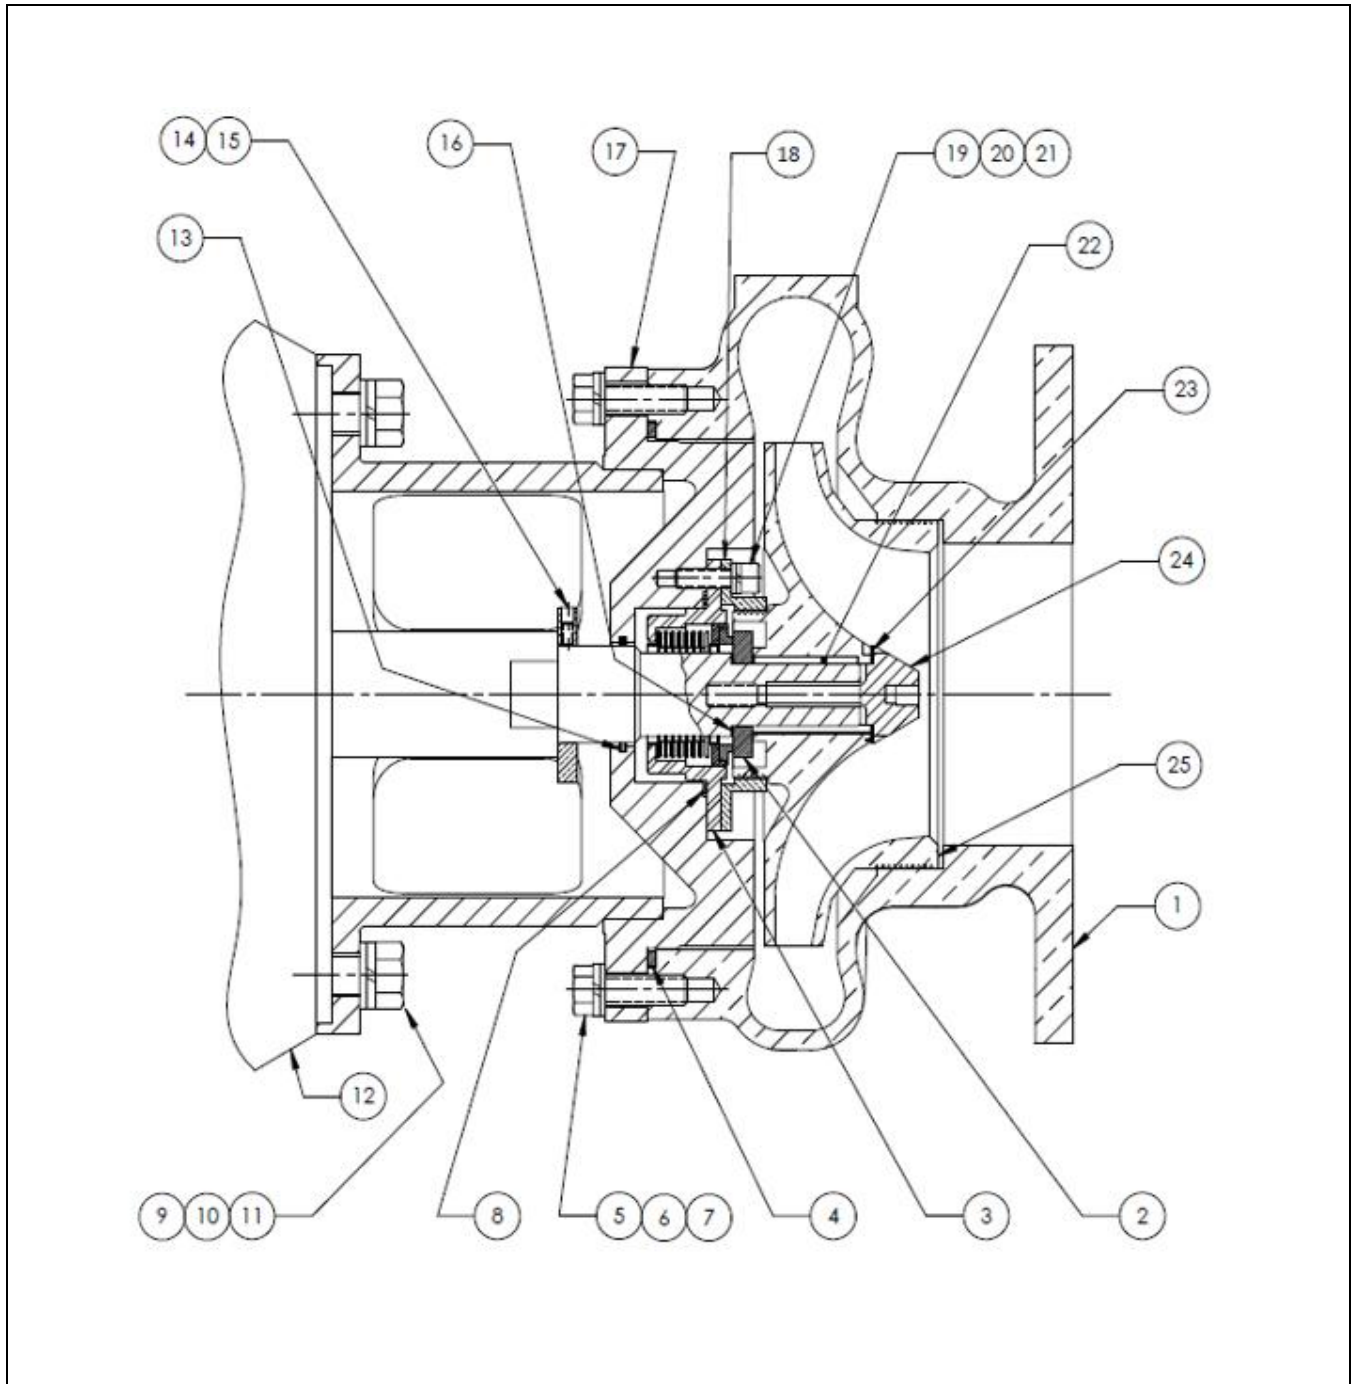

CRYO-MACH SERIES – Model 2x4x6 C-C

PARTS LIST

Cross Section Drawing No.	Qty	Part Number	Description	Material	Notes
1	1	CRY-781006	Volute Housing	Bronze	
2.1	1	CRY-700030	Rotating Seal Ring	SST	Standard Service
2.2	1	CRY-700033	Rotating Seal Ring	Tungsten Carbide	Heavy Duty Service
3	1	70220	Seal Ass'y, Stationary	SST/C-Gr.	
4	1	CRY-G6-1016	Gasket, Volute	SST/Grafoil	
5	8	CRY-HB616-16-1500	Hex Head Bolt	SST	
6	8	CRY-LW616-094	Lock Washer	SST	
7	8	CRY-FW616-062	Flat Washer	SST	
8	1	CRY-G2-516	Gasket, Seal	SST/Grafoil	
9	4	CRY-HB816-13-1250	Hex Head Bolt	SST	
10	4	CRY-LW816-125	Lock Washer	SST	
11	4	CRY-FW816-063	Flat Washer	SST	
12	1	-	Motor with Special Shaft	-	Contact Factory
13	1	CRY-MS28782-23	Secondary Seal	Teflon	
14	1	CRY-721030	Deflector	Brass	
15	2	CRY-SS8-32-312	Socket Head Set Screw	Brass	
16	1-3	CRY-706200	Shaft Shim	Copper	
17	1	CRY-781122	Intermediate Housing	Bronze/SST	
18.1	1	CRY-707280	Brass Stop	Brass	Obsolete
18.2	1	CRY-711125	Rear Wear Ring	Bronze	
19.1	6	CRY-SH416-20-750	Socket Head Cap Screw	SST	w/Brass Stop Obsolete
19.2	6	CRY-SH416-20-875	Socket Head Cap Screw	SST	w/Rear Wear Ring
20	6	CRY-LW416-062	Lock Washer	SST	
21	6	CRY-FW416-063	Flat Washer	SST	
22	1	CRY-K316-1400	Impeller Key	Brass	
23	1	CRY-706210	Lock Washer, Impeller	SST	
24	1	CRY-700731	Impeller Screw	Bronze	
25.1	1	720410-6500	Impeller	Bronze	w/Brass Stop Obsolete
25.2	1	940622-6500	Impeller	Bronze	w/Wear Ring
27	4	CRY-DS-0-250	Drive Screw	SST	

